

SERVICE BULLETIN

AMATEUR RADIO


SUBJECT

TM-211/411 AF GAIN CONTROL PART CHANGE

DATE


9-16-85

The original AF Gain control (R05-3424-15) has been replaced by a new part, with a new part number. The new part differs in mounting method and appearance. This should cause the operator no problems, and only requires a little change in the mounting method. The diagrams below are self explanatory:


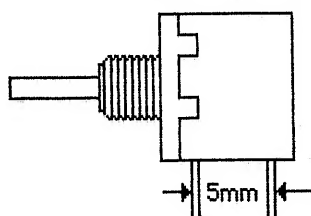
R05-3424-05 or
R05-3424-15


Old style

R05-3433-05

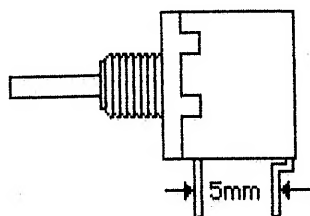

New style

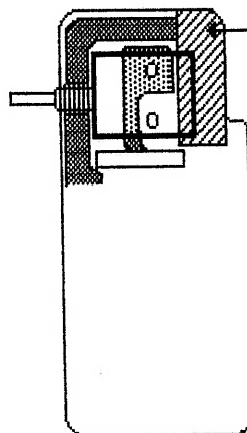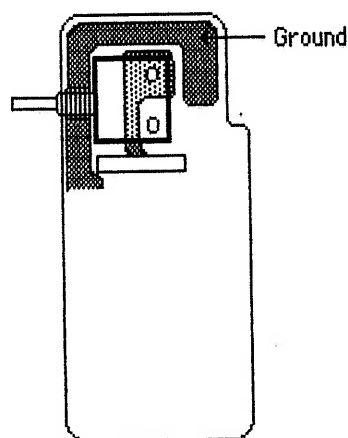

Place a piece of mylar tape in this area when installing the new type switch. The new switch is a little larger and must have some insulation beneath it to prevent shorts with the ground foil.

Time required for this modification is 1 hour or less. ©TKC985CLM